

EVALUATION OF COSO GEOTHERMAL EXPLORATORY HOLE NO. 1 (CGEH-1)  
COSO HOT SPRINGS KGRA, CHINA LAKE, CA

C. Goranson, R. Schroeder, and J. Haney  
University of California  
Lawrence Berkeley Laboratory  
Berkeley, California 94720

The well CGEH-1 (Coso Geothermal Exploratory Hole No. 1) was drilled at the China Lake Naval Weapon Center under the supervision of DOE/NVO and CER Corporation by Big O Drilling Company. They started drilling on 2 September 1977 and completed the well on 1 December 1977 to 4845 feet. The well is an exploratory hole to determine geological and hydrothermal characteristics of the Coso Hot Springs KGRA. During drilling, numerous geophysical and temperature surveys were performed to evaluate the geological characteristics of CGEH-1. LBL performed eight temperature surveys after completion of the well to estimate equilibrium reservoir temperatures. Downhole fluid samples were obtained by USGS and LBL, and a static pressure profile was obtained.

Two flow tests were attempted in 1978. The first test began September 5, 1978 used nitrogen stimulation to initiate flow, but resulted in small flow and subsequent filling of the bottom hole with drill cuttings. The second test, on November 2, 1978, utilized a nitrogen-foam-water mixture to clean residual particles from bottom hole and nitrogen was then used to stimulate the well. The well again was dry after stimulation. Water influx was calculated at 4-5 gal/min as the well filled after unloading of the wellbore.

Figure 1 shows the location of Coso Hot Springs. Figure 2 illustrates the location of CGEH-1 relative to heat flow contours obtained by ARPA (Advanced Research Projects Agency) and DOE heat flow holes. Numerous geological and geophysical studies were performed (1-18) prior to the drilling of CGEH-1. However, the geological characteristics of the Coso area are rather complex. This is illustrated in the aforementioned references. The area consists essentially of a ring fracture zone located in the basin and range province east of the Sierra Nevada range (19). Figure 3 illustrates generalized alteration, geophysical characteristics, and active thermal areas in the Coso Hot Springs area.

## WELL COMPLETION--CGEH-1

The drill site is on rhyolite pyroclastic debris covering a granite complex. Rhyolite dikes intrude and are probably contemporaneous with the extruded rhyolite domes in the vicinity. Faults and fracture zones had a strong influence in hole direction and penetration rates. Figure 4 shows the surface projected horizontal deviation of the well. Maximum horizontal displacement was calculated to be 375 feet at S70° 20'W. As shown in the figure, three large meanders in the wellbore occurred during drilling. Final bottom hole vertical depth is approximately 4815 feet (total drilled depth, 4845).

Figure 5 is a synopsis of the completion record. Three large mud losses occurred along the cased portion of the well (CGEH-1 is cased to 3488 feet). An influx of water at a rate of 90 BPH was observed at about 1900 feet. Above this zone, at about 1660 feet, running clay and gravel entered the wellbore. The gravel was subangular and the clay is actually powdered granite with clay-sized particles. Numerous mud losses occurred below 3500 feet. However, it is not known whether this mud went into the fractured zone near 3500 feet or if other fractures intersect the well below this point.

## THERMAL EQUILIBRIUM PERIOD, December 1977--September 1978

LBL performed eight temperature surveys (21) before the first flow test. The final recorded maximum temperature was 382°F at 1900 feet. The water level varied, but was found at approximately 890 feet. Figure 6 shows five of eight temperature surveys. The figure illustrates that zones above 3500 feet (1900, 2700, 3500 feet) where large mud losses occurred during drilling show atypical temperature distribution indicating that the formation was cooled from mud entry. However, zones below 3500 feet where numerous mud losses are observed do not illustrate this abnormal behavior. This seems to indicate that the mud losses below 3500 feet probably entered the large fracture zone above 3500 feet and not into fractures below the portion of the well that was subsequently cased. However, there was a large mud loss at T.D.

Downhole chemical samples (21) of wellbore fluid were also obtained during this initial equilibrium period. Dissolved silica concentrations from bottom hole samples indicate a temperature of 338°F (201/mb/l). Silica temperatures at 2740 feet were calculated to be 194°F (40 mb/l).

The cause of these discrepancies is unknown. However, the drill pipe was stuck at 3488 for a short period. Pipe release and diesel fuel were added to free the drill bit. The presence of residual organics in the wellbore might explain low silica concentrations observed at the 2700 foot depth. (23)

#### FLOW TEST 1

The first extended flow test was carried out September 5 to 8, 1978. During the well stimulation and subsequent flow the wellhead temperature was 262.5°F (128°C) and the discharge tube temperature was 250°F (123°C). This occurred during the nitrogen lift at 300 CFM of heated N<sub>2</sub> with the tube at 2060 feet. The nitrogen flow rates were varied as the tube was lowered to the final depth, 4590 feet. When the nitrogen was shut off, the flow decreased to nearly atmospheric pressure at the discharge tube within one-half hour. The wellhead temperature dropped at 95°C at this point. Within five minutes of shutting off the nitrogen, the flow had decreased appreciably. The well was then pressured with 2000 psi pressure at the nitrogen truck for one-half hour. At this time, the tubing was terminated at 4590 feet downhole. The wellhead pressure at this time was 370 psi and nitrogen was pumped at 200 cfm. The well was open and unloaded an unknown quantity of water, then died. An attempt was made to find a liquid level with the N<sub>2</sub>, but the attempt was unsuccessful. The N<sub>2</sub> tubing was then lowered to 4700 feet but no nitrogen returns were observed and the nitrogen pressure reached 3000 psi. When the tubing was removed, the lower 250 feet of tubing was plugged with sand and clay. At this point the flow testing was terminated.

#### FLOW TEST 2

The second flow test utilized a nitrogen-foam-water mixture to clean the bottom portion of the well below 4700 feet. The well cleanup and stimulation began on November 5, 1978 by injecting foam at 1000 feet and slowly lowering the injection tube while continuing to pump foam. Good returns were obtained during the descent. A wellhead sample of the foam was taken for analysis. The sample showed large amount of grey clay-like material entrained in the foam. Subsequent analysis by R. Clark (DOE/NVO) indicated that the material was fine

powdered granite, not clay. At this point over 100 feet of material was being circulated out of the well, but further progress was not possible due to an obstruction at 4695 feet. An attempt was made to withdraw the tubing, but it could only move a maximum of about 60 feet upward. The tubing moved freely downward, but could not be withdrawn more than about 60 feet upward. The tubing was worked up and down a few times and finally came free. However, when it came to the surface there was about 145 feet that had been left in the well.

During the cleanout procedure, fluid samples were taken from a tube at the wellhead using a high-pressure needle valve for metering. This valve was subsequently plugged with sand grains brought up with the foam. The sand was retained as a sample of the material removed from the well. Before removing the nitrogen injection tube, the well was cleaned to 4695 feet by circulating a water-foam mixture for four hours. After four hours, the well was cleaned by pumping clean water for one hour followed by nitrogen until the well reached its maximum flowing temperature and pressure at the critical discharge tube. The nitrogen was shut in and the well flowed for less than five minutes, after which the temperature and flow decreased rapidly. The wellhead temperature was 95°C and flow was essentially pure steam. After the nitrogen tube was brought to the surface a different end was made up to try to pass the blockage at 4695 feet. The well was again foamed (this time at 3500 feet) and the tubing was lowered after returns were obtained. The tubing encountered a block at 4490 feet. The well was again cleaned and stimulated with nitrogen. The well again died in less than five minutes after stimulation. The nitrogen was then pumped at 3000 psi with the wellhead shut in for about 15 minutes. The 2" and 4" discharge tubes were then opened. No show of water was seen, only nitrogen. No subsequent show of water was found with the well open for 12 hours. A water-level tool was then used to monitor the position of the water level in the well. The water level was first found at 3645 feet. This was about 23 hours after the final pressurization and flow of the well, and 12 hours after shutting in the well. This is an average increase in water level of about 1.3 ft/min  $\approx$  4 gal/min. The water level was subsequently monitored closely and it was seen that the time required for the water level to rise 1 foot was decreasing slightly as the height of the water column increased. This continued

up to 3460 feet, at which time the rate of filling began to decrease. Since the latter depth is approximately the depth to which the well is cased, we are forced to conclude that the well was not filling from the bottom, but instead the water was coming from the well annulus at the bottom of the casing. Following the well fill-up measurements, the testing was terminated.

#### CONCLUSIONS

The well was drilled in very hard rock. It was extremely difficult to prevent drill bit wandering, and the final bottomhole location is  $\sim$  374 feet (horizontal) from the wellhead location with three serious meanders (see Figure 1). During the monitoring of the thermal equilibration, at least 15 downhole surveys were run over a period of about 10 months. Our final surveys, before the workover began, indicated considerable friction below the casing. During the cleanout the nitrogen tubing was broken with a piece apparently lodged between 4490 and 4635 feet. This suggests that the well is currently unuseable at the present time below about 4000 feet due to either cable and wireline cuts in the uncased curved well, fractures which have been opened during the downhole activity, or opening of a fracture during drilling. (The drill bit was stuck temporarily at 4771 feet.)<sup>20</sup> Since the well had about 200 feet of ~~drill~~, and since the flow seems to come down the wellbore, the tension could also have been due to a sticky layer of clay (powdered granite) in the well. It is not likely that there are serious cable grooves below 4500 feet, and the origin of the fill is unknown, hence it is likely that the tubing was stuck in a fracture.

During drilling there were several circulation losses while using mud. The deepest circulation loss occurred at bottomhole, where more than  $\sim$  1400 bbls ( $\sim$  59,000 gals) of mud was lost, as shown in Figure 5. This large quantity of mud, plus the material added to the mud to prevent further losses to the fracture, make production from this zone questionable. The apparent lack of significant influx from the lower zone (recall that the maximum influx during well fill-up after cleanout was about 5 gals/min) leads us to conclude that the lower zone is not of significant interest for production of geothermal fluids at this time. When the temperature log is examined, the bottomhole can be seen to be about  $40^{\circ}\text{F}$  cooler than the zones which are about half as deep.

The well was cased to about 3500 feet. The largest mud losses during drilling occurred in the zone adjacent to the casing shoe, i.e., in the zone from 3260 to 3500 feet, as shown in Figure 2. (20) In this zone, up to 4000 bbls (168,000 gals) of drilling mud and lost circulation material was lost (note that this follows only if the mud losses while drilling from 3600 to  $\sim$  4500 feet are all assumed lost in this interval). This zone shows up as a broad temperature depression in the temperature logs taken during thermal equilibration of the well as shown in Figures 5 and 6. It is likely that this zone is contributing the 3-6 gpm of influx that fills the well when the latter is emptied during the flow tests. The mud lost in this zone has a volume equal to about 20,000  $\text{ft}^3$ . Assuming an effective porosity of 10 percent we have a damage radius which is at least 17 feet. If this zone contributes all of the flow to the well, the head is  $3260 - 900 = 2360 \text{ ft.} = 1015 \text{ psi}$ . At  $\sim 385^\circ\text{F}$  this is well above the saturation curve for pure water, and implied that the fluid source is liquid, not steam. The chloride content of the well was the same as that at Coso Hot Springs.<sup>14</sup> The pieziometric head at both Coso Hot Springs and CGEH-1 is approximately 3500 feet about sea level.

While the mud losses are not quite so enormous in the two zones about 3200 feet they are still appreciable. One fracture was encountered at  $\sim 2750$  feet where more than 2100 bbls ( $\sim 88,000$  gals) of mud and various materials were lost during drilling. The shallowest and hottest zone was at 2060 feet, where more than 900 bbls (37,800 gals) were lost. It is also noteworthy that at 1900 feet a water influx of at least 60 gpm occurred while drilling under pressure with air. A switch to mud was made at that point, hence there is no indication of how much the formation could flow from that zone.

Several water samples have been taken during the course of the well equilibration and during the well tests. These water samples probably came from the zone near the bottom of the casing. It is also likely that there has been contamination of the fluid samples by drilling mud and other foreign material. It is unlikely that we have sampled the uncontaminated reservoir fluid. On the other hand, it is

equally unlikely that the source of fluid near CGEH-1 is at an appreciably higher temperature than observed in this well (< 390°F). All of the sand, clay, and fluid samples that were taken during the recent work are being held at LBL.

Although numerous problems were encountered during the drilling of CGEH-1, it has proved valuable in the initial hydrogeological evaluation of the Coso Hot Springs area. Further drilling in the area is necessary to provide a more complete evaluation, and the Coso Hot Springs KGRA shows promise for development of power production or direct heat utilization.

#### ACKNOWLEDGEMENTS

We wish to thank many people for their assistance during these studies. In particular, R. Clark (DOE/NVO) has provided valuable suggestions, corrections, and encouragement. The work could not have been completed without the assistance of the NWC geothermal group or Captain R. Wilson (USN).

## REFERENCES

- 1 Austin, C.F., Austin, W.H., Jr., and Leonard, G.W., 1971, Geothermal science and technology--a national program: Naval Weapons Center Tech. Ser. 45-029-72, 95 pp.
- 2 Austin, C.F., and Pringle, J.K., 1970, Geologic investigations at the Coso thermal area: Naval Weapons Center Tech. Pub. 4878, 40 PP.
- 3 Chapman, R.H., Healey, D.L., and Troxel, B.W., 1973, Bouguer Gravity Map of California, Death Valley Sheet: California Division Mines and Geology, Scale 1:250,000.
- 4 Combs, J., 1975, Heat flow and microearthquake studies, Coso Geothermal Area, China Lake, California: Final Report to Advanced Research Projects Agency, ARPA Order No. 2800, Contract NO. N00123-74-C-2099, 65 pp.
- 5 Combs, J., and Rotstein, Y., 1976, Microearthquake studies at the Coso Geothermal Area: in Proceedings of Second United Nations Symposium on the Development and Use of Geothermal Resources, in press.
- 6 Duffield, W.A., 1975, Late Cenozoic ring faulting and volcanism in the Coso Range area of California: Geology, v.3, p. 335-338.
- 7 Frazer, H.J., Wilson, H.B.D., and Hendry, N.W., 1943, Hot springs deposits of the Coso Mountains: California Jour. Mines and Geol., v. 38, p. 223-242.
- 8 Furgerson, R.B., 1973, Progress report on electrical resistivity studies, Coso geothermal area, Inyo County, California: Naval Weapons Center Tech. Pub. 5497, 38 pp.
- 9 Godwin, L.H., Haigler, L.B., Rioux, R.L., White, D.E., Muffler, L.J.P., and Wayland, R.G., 1971, Classification of public lands valuable for geothermal steam and associated geothermal resources: U.S. Geol. Survey Circ. 647, 18 pp.
- 10 Koenig, J.B., Gawarecki, S.J., and Austin, C.F., 1972, Remote sensing survey of the Coso geothermal area, Inyo County, California: Naval Weapons Center Tech. Pub. 5233, 32 pp.

- 11 Lanphere, M.A., Dalrymple, G.B., and Smith, R.L., 1975, **K-Ar ages** of Pleistocene rhyolitic volcanism in the **Coso Mountains**, California: **Geology**, v. 3, p. 339-341.
- 12 Teledyne Geotech, 1972, Geothermal noise survey of the **Coso Hot Springs** area, Naval Weapons Center, China Lake, CA: unpublished Technical Report No. 72-6 produced under contract for the Naval Weapons Center, 18 pp.
- 13 Hulen, J.B., 1978, Geology and alteration of **Coso Geothermal area**, Inyo County, California, UURI-ESL Report DOE Contract EG-78-C-07-1701.
- 14 R.M. Gailbraith, Geological and Geophysical Analysis of **Coso Geothermal Exploratory Hole No. 1** (CGEH-1), **Coso Hot Springs KGRA**, California, May 1978. UURI-ESL Report.
- 15 FOX, R.C., 1978a, Dipole-dipole resistivity survey of the **Coso Hot Springs KGRA**, Inyo County, California, UURI-ESL Report.
- 16 FOX, R.C., 1978b, Low-altitude aeromagnetic survey of the **Coso Hot Springs KGRA**, Inyo County, California, UURI-ESL Report.
- 17 Le Shack, L.A., 1977, Preliminary 2-meter temperature map 22-23 September, **Coso**, California: Development and Resources Transportation ERDA Contract No. EG-77-C-01-4021.
- 18 Roquemore, G. R., 1978a, Active faults and related seismicity of the **Coso Mountains**, Inyo County, California: **Seism. Soc. America Earthquake Notes**, v.49, no.1, p.24.
- 19 Roquemore, G.R., 1978b, Evidence for basin and range/Sierra Nevada transitional zone structures in the **Coso Mountains**, California: **Geol. Soc. America Abstracts w/programs**, v. 10, no.3, p. 144.
- 20 **Coso Geothermal Exploratory Hole No. 1**, CGEH No. 1, Completion Report, March 1978. NVO 0655-04.
- 21 State Downhole characteristics of Well CGEH-1 at **Coso Hot Springs**, California, June 1978. LBL-7059, C. Goranson, R. Schroeder.
- 22 Combs, J. February 1978, Geothermal exploration techniques: A case study. University of Texas at Dallas, EPRI, ER-680 project 375. Final Report pps. 27-65.

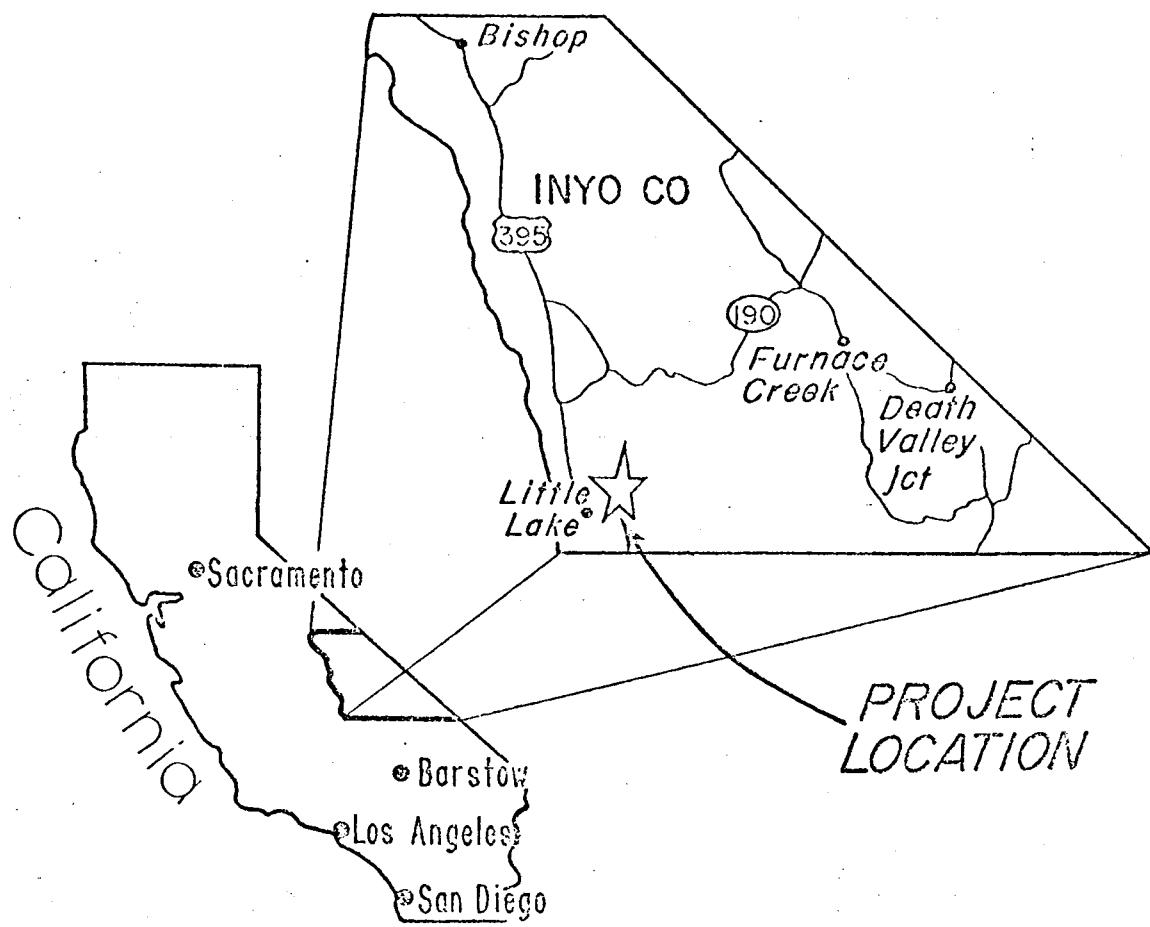


Figure 1. The location of the China Lake Naval Weapons Center.

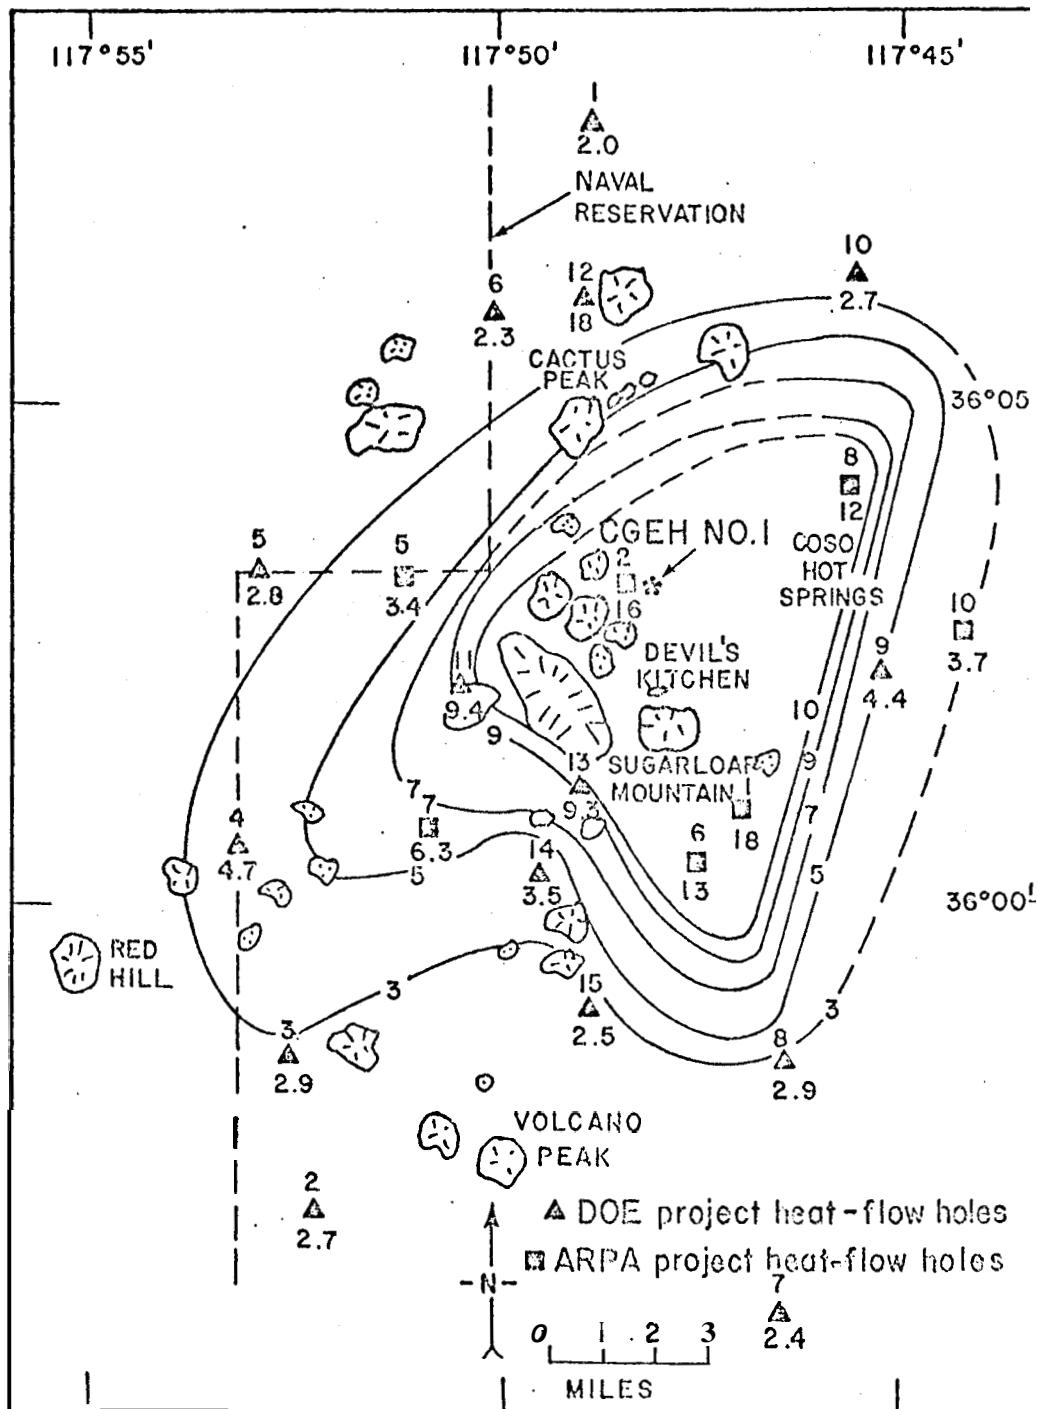


Figure 2. Generalized map of thermal anomalous region and CGEH No. 1 well location. The numbers in the figure identify the hole and (below) give the heat flow in KFU.

R38E | R39E

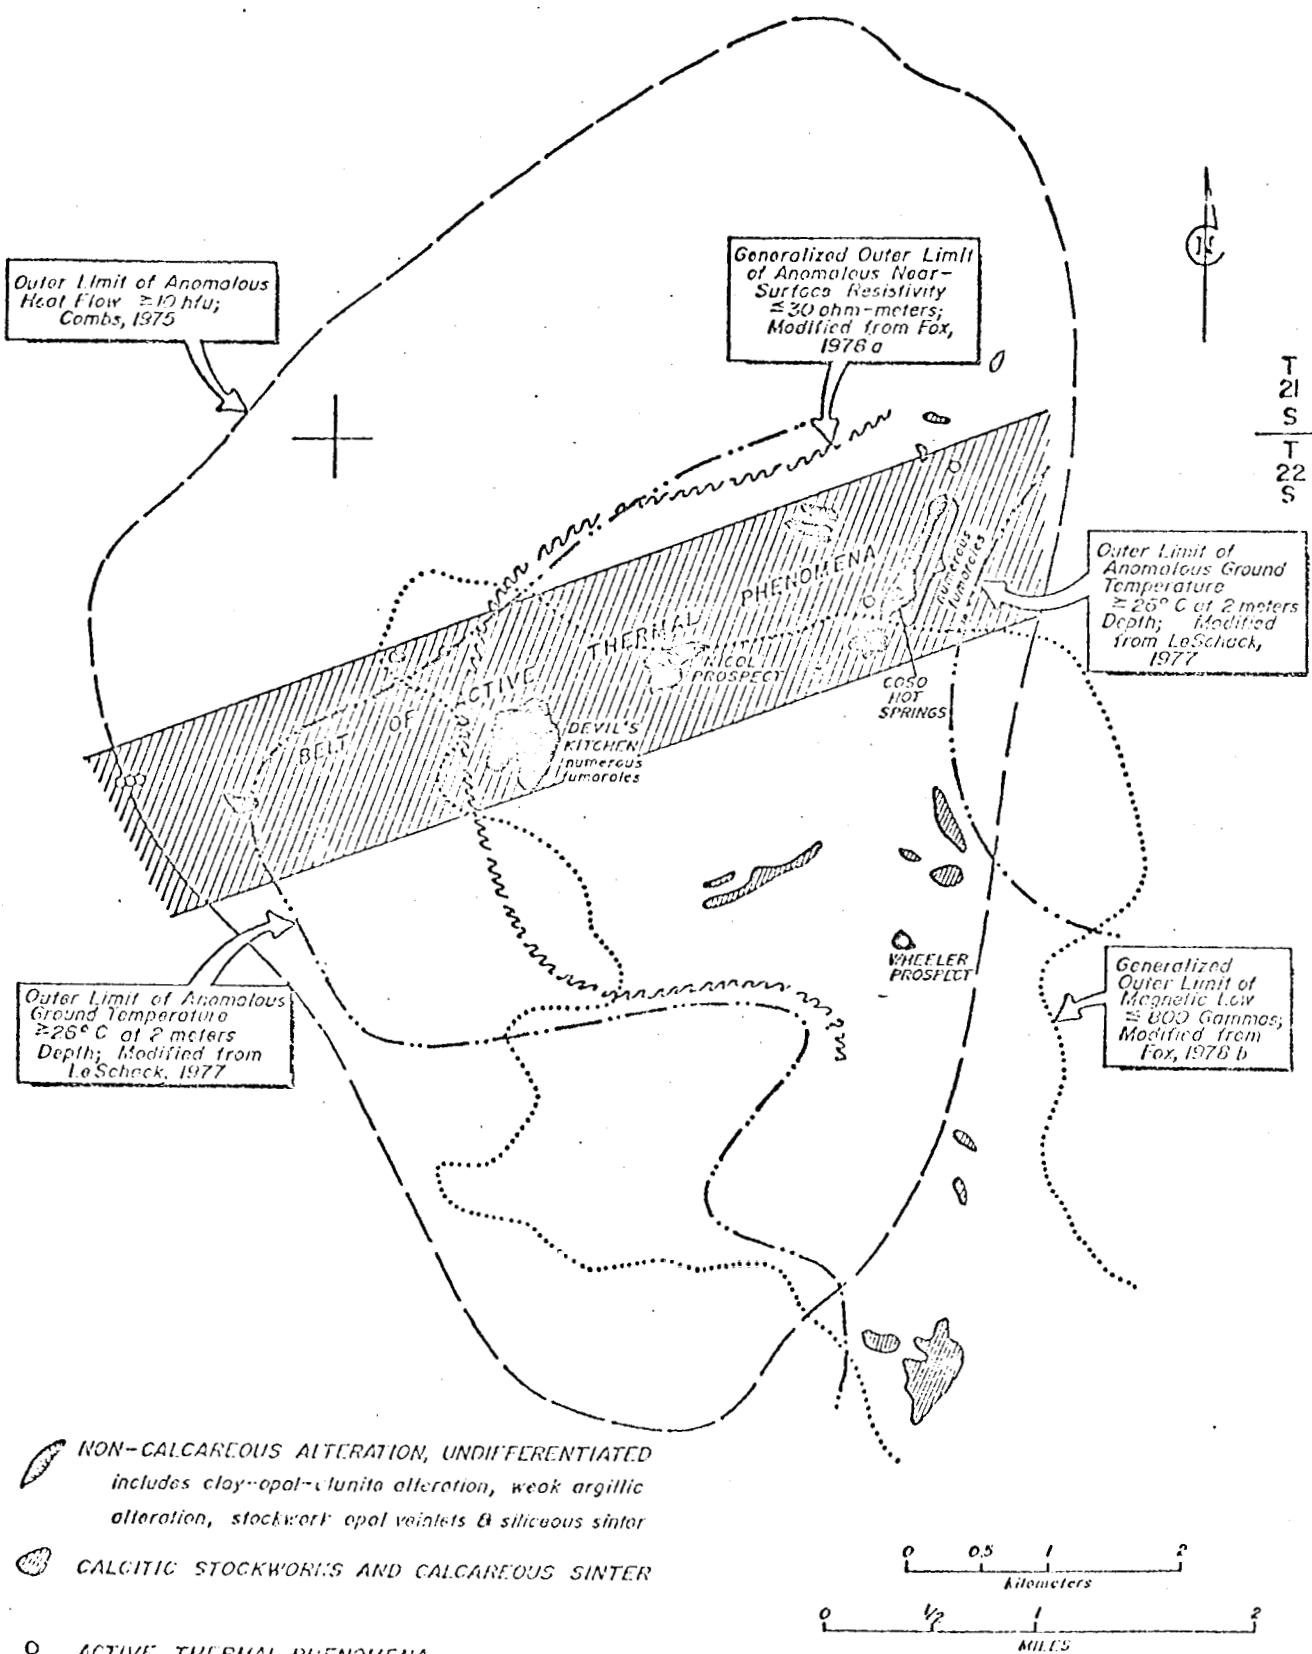


FIGURE 3  
GENERALIZED ALTERATION  
AND GEOPHYSICAL MAP

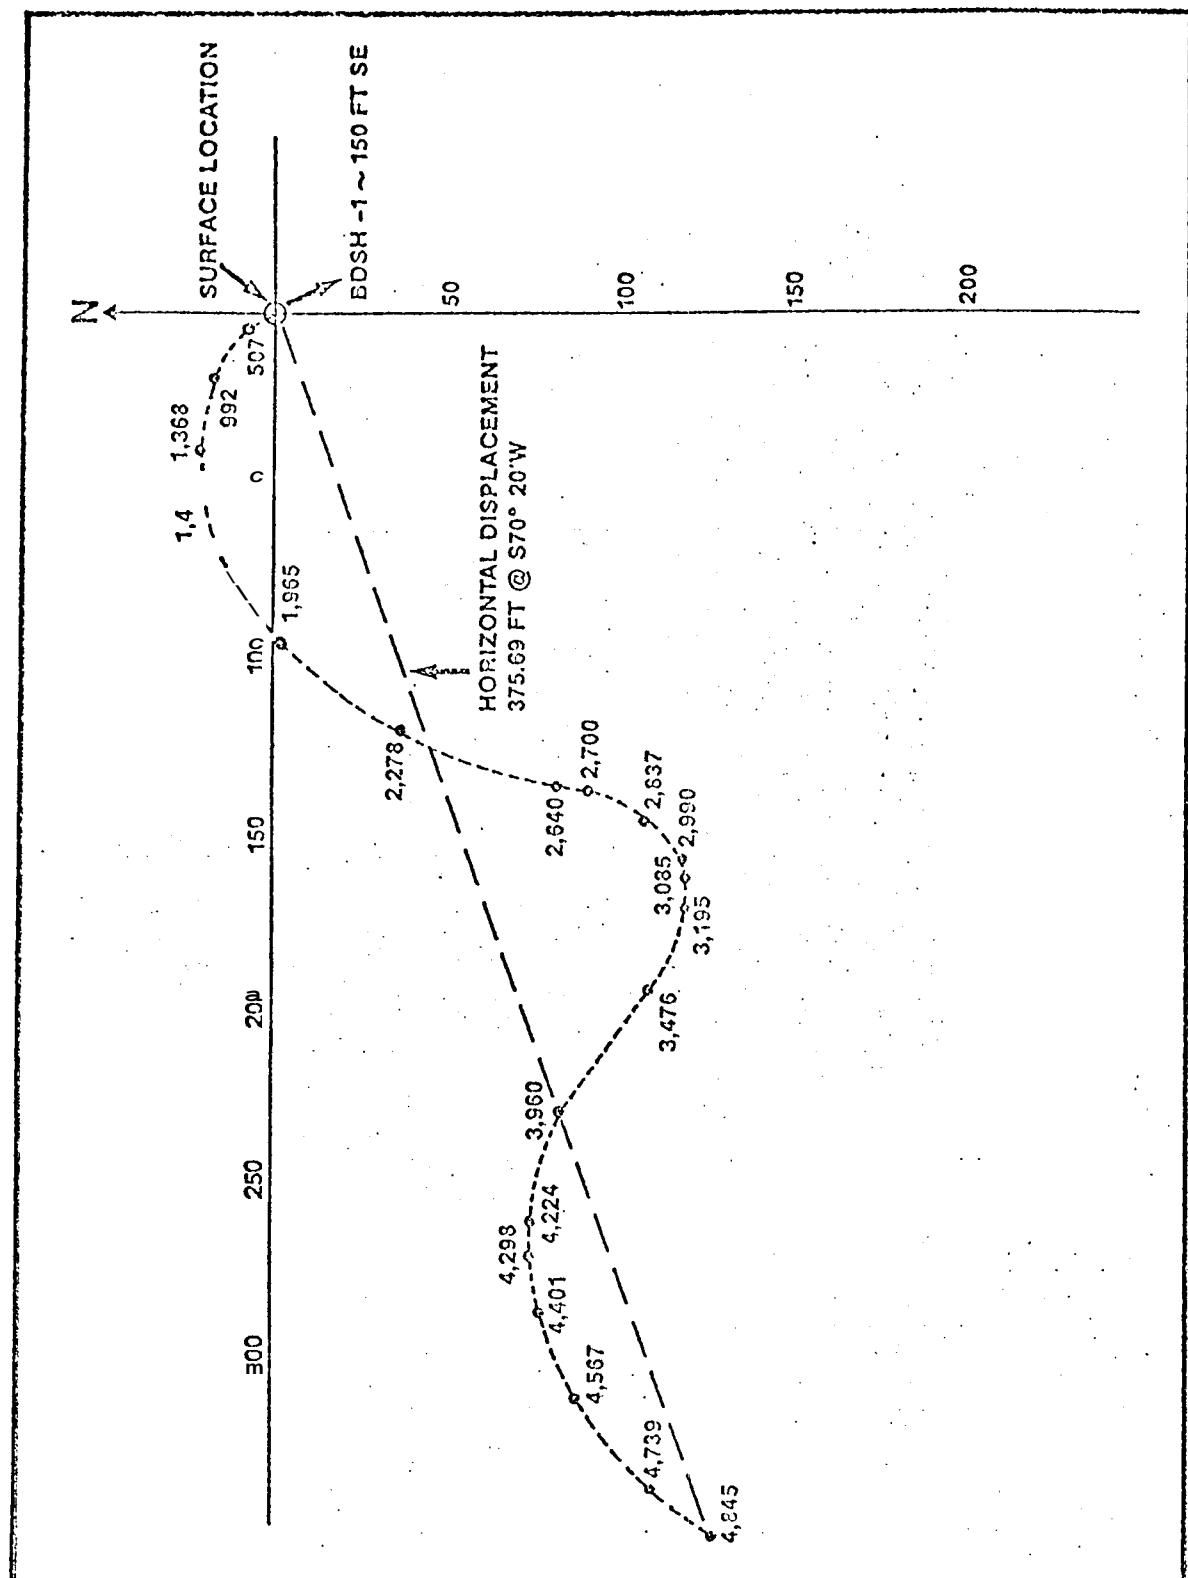


FIGURE 4 : HORIZONTAL PROJECTION OF DISPLACEMENT IN FEET PLOTTED AS A FUNCTION OF MEASURED DEPTH

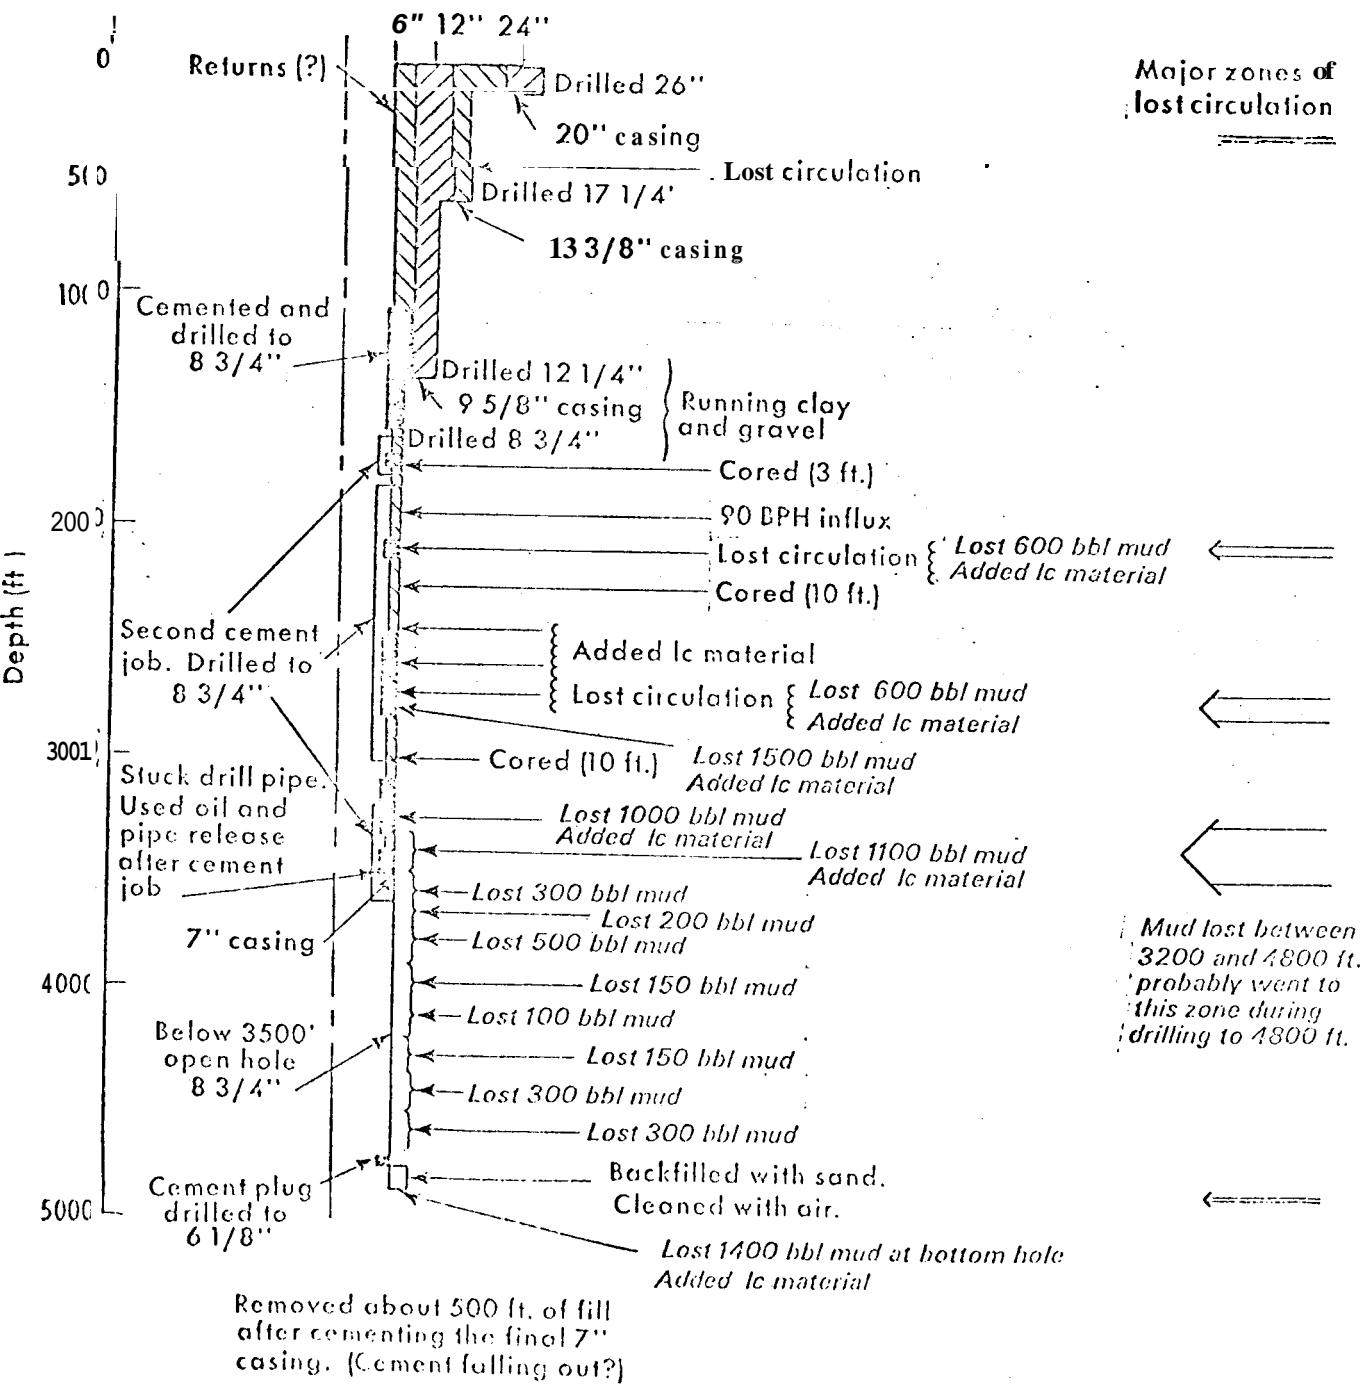


FIGURE 5

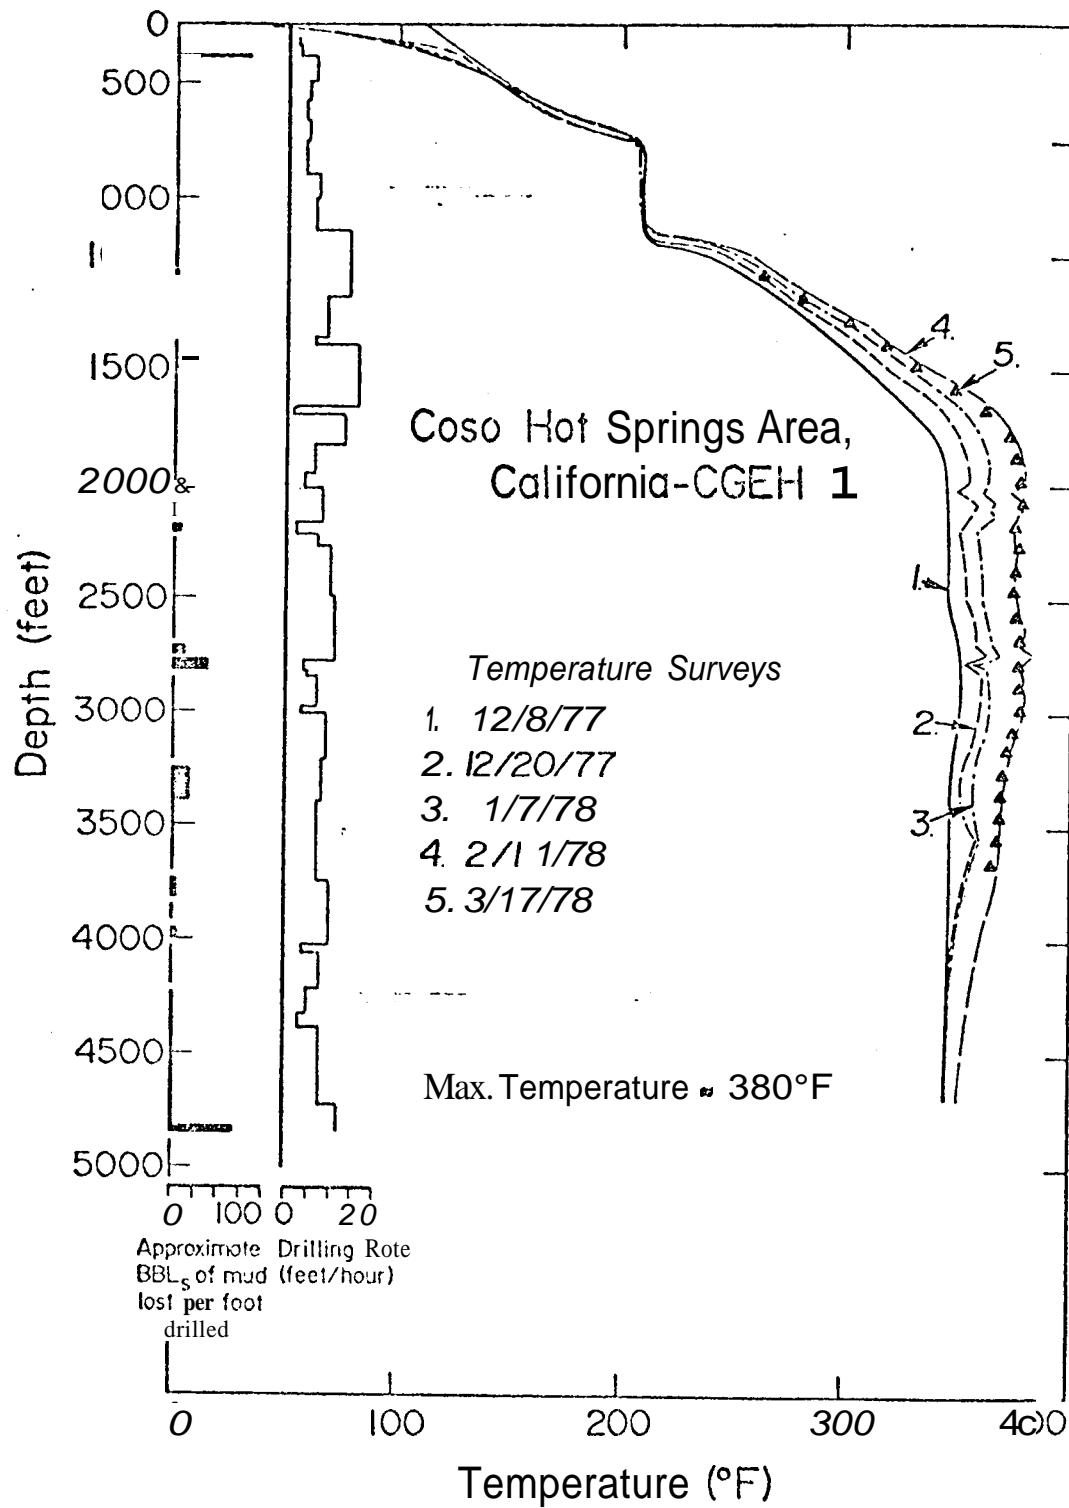


Figure 6. Temperature Surveys in the Static Steam and Water Column at Coso Hot Springs.